

For information about other American International automotive accessories visit our website at:

<http://www.americaninternational.net>



**American
International**
Car Stereo Installation Kits & Accessories



HYNK1137 Mounting Kit



American International

Automotive Products Division

1040 Avenida Acaso • Camarillo, CA 93012, U.S.A.

USA Sales (800) 336-6500

Canada Sales (888) 922-3006 • USA Fax (805) 388-7950

CUSTOMER HELP LINE
USA 800-323-4329 • Canada 800-245-8777

iHYNK1137

VEHICLE APPLICATIONS

Hyundai
2006-08 SONATA


DASH DISASSEMBLY

1. Open the glove box, and remove the (2) phillips screws from the upper front edge of the glove box.
2. Carefully pry the thin curved dash trim panel outward and remove.
(Note: This part goes from above the ignition key to above the glove box area).
3. Remove the (1) phillips screw securing the lower edges of each side trim located beside the radio.
4. Carefully pry these individual side trims forward to release. (Note: be sure to not lose the retainer clips). Disconnect the attached harnesses and remove trim pieces.
5. Remove the (2) phillips screws securing the lower edge of the factory radio to the sub-dash.
6. Remove the (4) phillips screws securing the radio to the sub-dash, pull radio forward, disconnect all wire harnesses and antenna lead and remove radio.

INSTALLATION INSTRUCTIONS

1. Insert radio between ISO mount brackets and loosely attach to sides of radio using screws provided with radio when possible or hardware included with kit.
2. Slide radio component forward or backward for desired look and tighten screws.
3. Test fit kit/radio by mounting it using the (2) OEM screws, and making sure the main frame of the HYNK1137 aligns correctly and does not leave any gaps when installed. If everything looks correct go to step #4. If not, go back to step # 2.
4. Attach the metal panel fastener clip from the factory radio (1) to the mounting tab on the back side of the HYNK1137 panel.
5. Suggested... Attach a rear support bracket to the rear of the new radio and adjust as necessary

Fig. A

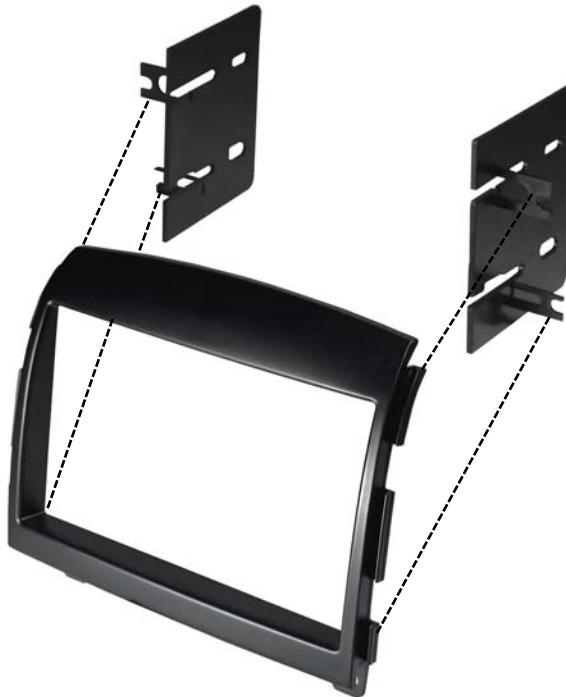

NOTES