

1998-2000 NISSAN PATHFINDER

1. Remove the (2) phillips screws from the lower edge of the Radio trim bezel.
2. Gently pry outward on the Radio trim bezel to release the panel.
3. Remove the (4) phillips screws securing the Radio.
4. Gently slide the Radio forward, disconnect the wire harnesses and antenna lead.

2001-02 NISSAN PATHFINDER 2003-04 NISSAN PATHFINDER SE

1. Carefully unsnap and remove vent/clock assembly above radio (panel removal tool required).
2. Remove (2) phillips screws from Radio dash trim above Climate Controls (one on each side).
3. Carefully remove trim from around the Radio/Climate Controls.
4. Disconnect all harnesses attached to Climate Control trim panel, Lighter, and Hazard controls then remove trim bezel.
5. Remove (4) phillips screws securing Radio to sub-dash.
6. Slide Radio forward, disconnect all Radio harnesses and antenna lead and remove the Radio.


For information about other American International automotive accessories visit our website at:

<http://www.americaninternational.net>

Automotive Products Division
1040 Avenida Acaso • Camarillo, CA 93012, U.S.A.
USA Sales (800) 336-6500
Canada Sales (888) 922-3006 • USA Fax (805) 388-7950

CUSTOMER HELP LINE
USA 800-323-4329 • Canada 800-245-8777

NTR708

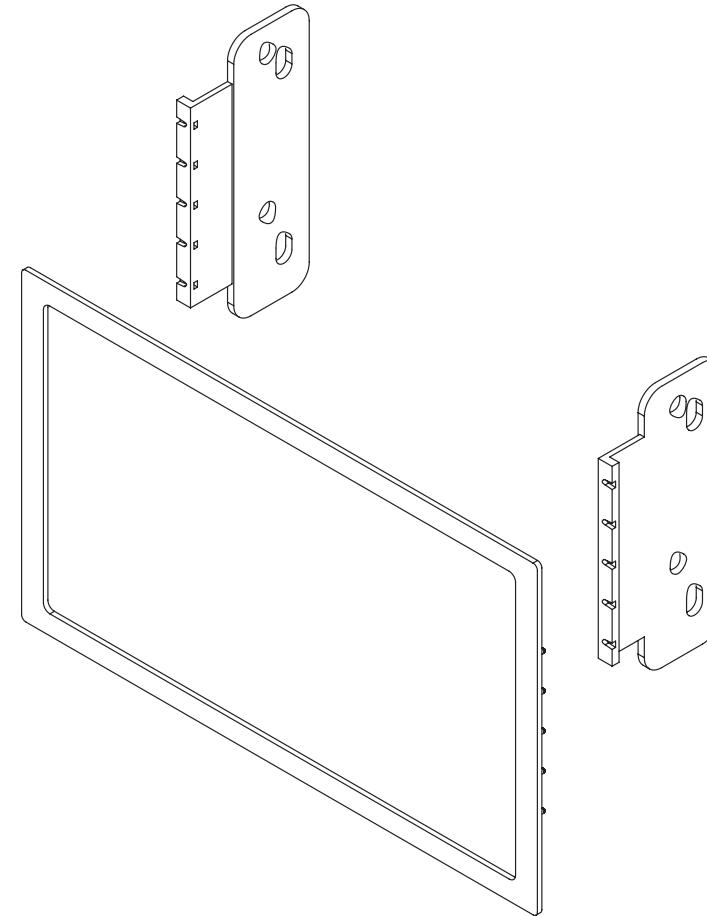


VEHICLE APPLICATION

| | |
|------------------|----------------|
| Mercury | 1993-03 QUEST |
| 1993-02 VILLAGER | 1995-99 SENTRA |
| Nissan | 2000-04 XTERRA |
| 1995-98 200SX | |
| 1998-01 ALTIMA | |
| 1998-04 FRONTIER | |
| 1995-99 MAXIMA | |

DOUBLE DIN INSTALLATION INSTRUCTIONS

1. Attach the Left and Right brackets to the main NTR708. As shown in fig A.
2. Attach the factory metal mounting brackets to the left and right rear sides of the Double Din radio using 2 of the screws removed from the factory radio.
3. Align the left and right NTR708 brackets to the appropriate sides of the aftermarket radio and attach using the remaining 2 screws supplied with radio when possible.

Figure A

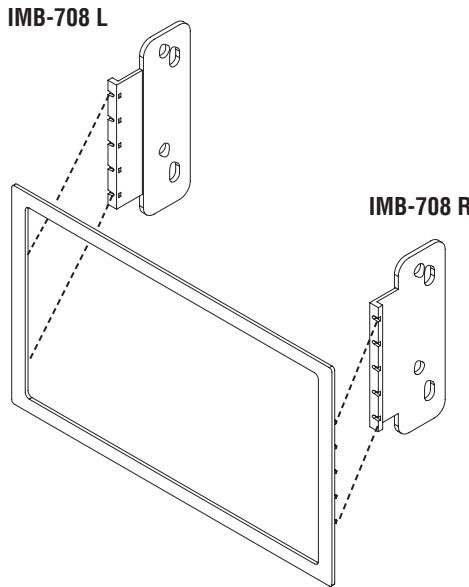

DASH DISASSEMBLY INSTRUCTIONS

1993-98 NISSAN QUEST / MERCURY VILLAGER

1. Remove (1) screw in center top portion of dash trim surrounding A/C, heater, radio and storage box. Unsnap dash trim.
2. Remove (4) screws from the front sides of factory radio. Slide radio forward enough to disconnect power, speakers and antenna. Remove radio.

1999-2003 NISSAN QUEST 1999-2002 MERCURY VILLAGER

1. Slide the Drink tray/Ashtray assembly outward.
2. Depress the release tabs (one on each side) at the rear of the drink tray assembly, and slide outward.
3. Remove the (2) phillips screws at the bottom of the inside lip of the Drink tray location.
4. Gently unsnap the top portion of the Radio trim bezel to release, and push in at the bottom edge and slide the entire panel upward to remove.
5. Remove the (2) phillips screws securing the radio.
6. Gently lift upward on the left side of the Radio to lift over the retaining tab and pull the Radio forward.
7. Slide the Radio forward. Disconnect wire harnesses and antenna lead.

1995-99 NISSAN SENTRA 1995-98 NISSAN 200SX

1. Gently pry upward on the cover cap located between the Hazard and Defroster switches and remove.
2. Remove the (1) phillips screw from this location.
3. Using a panel removal tool, gently unsnap the Radio trim bezel from around the radio and Heater controls.
4. Unplug the wire harnesses from the panel and remove.
5. Remove the (4) phillips screws securing the radio.
6. Gently pull the Radio forward and disconnect the wire harnesses and antenna lead and remove the radio.

1998-2001 NISSAN ALTIMA

1. Gently lift up on the trim around the shift lever, starting from the rear and remove.
2. Remove the (2) phillips screws from the trim panel above the Radio.
3. Remove the (2) phillips screws from the bottom of Radio trim bezel.
4. Gently pry outward the Radio trim bezel starting at the bottom to release the panel snaps.
5. Disconnect the lighter harness and remove the Radio trim bezel.
6. Remove the (4) phillips screws securing the Radio to the dash.
7. Gently slide the Radio forward, disconnect the wire harness and antenna lead and remove from the dash.

2002-04 NISSAN FRONTIER 2002-04 NISSAN Xterra

1. Carefully lift upward on trim around shift lever and remove trim.
2. Remove (2) phillips screws from lower front edge of Radio/Climate Control trim bezel.
3. Remove (2) phillips screws from the above radio.
4. Carefully remove Radio/Climate Control trim bezel
5. Remove (4) phillips screws securing radio to sub-dash
6. Carefully pull radio forward, disconnect wire harnesses and antenna lead, then remove radio.

1998-2001 NISSAN FRONTIER 2000-01 NISSAN Xterra

1. Remove the ashtray.
2. Remove the (2) phillips screws inside the ashtray cavity.
3. Gently unsnap the Radio trim bezel.
4. Remove the (4) phillips screws securing the radio.
5. Gently remove the Radio from the dash, disconnect the wire harness and antenna lead and remove.

1995-99 NISSAN MAXIMA

1. Gently lift up on the trim around the shift lever and remove.
2. Remove the (1) phillips screw from the left side of the ash tray.
3. Gently pull the ash tray forward to unsnap the right side, unplug the harness and remove.
4. Remove the (2) phillips screws from the bottom of the Radio assembly.
5. Using a panel removal tool, gently lift upward on the top vent/clock assembly.
6. Unplug the wire harnesses and remove the vent assembly.
7. Remove the (2) phillips screws securing the top of the Radio/Heater assembly to the dash.
8. Gently slide the Radio/Heater assembly forward and disconnect the harnesses and antenna leads and remove.
9. Remove the phillips screws securing the Radio to the side brackets, and remove the radio.

Continued on back page.