


For information about other American International automotive accessories visit our website at:

<http://www.americaninternational.net>



**American
International**
Car Stereo Installation Kits & Accessories

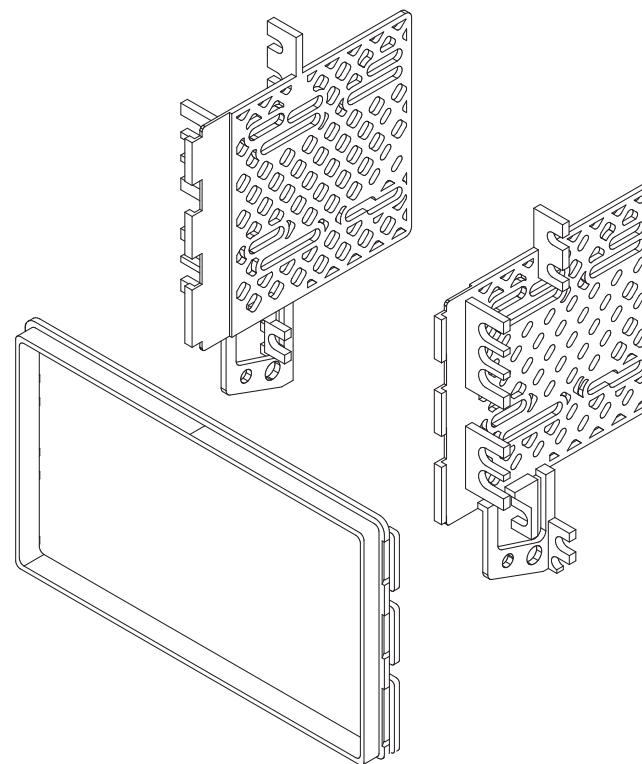

HYNK1119 Mounting Kit



American International

Automotive Products Division

1040 Avenida Acaso • Camarillo, CA 93012, U.S.A.

USA Sales (800) 336-6500

Canada Sales (888) 922-3006 • USA Fax (805) 388-7950

CUSTOMER HELP LINE

8am-4:30 P.S.T. Monday-Friday Except Holidays

USA 800-323-4329 • Canada 800-245-8777

iHYNK1119

VEHICLE APPLICATIONS

HYUNDAI

2001-06 ELANTRA (OVERSIZED RADIO)

2001-06 SANTA FE (OVERSIZED RADIO)

2002-05 SONATA

2003-08 TIBURON

2005-09 TUCSON

2001-06 HYUNDAI ELANTRA

DASH DISASSEMBLY

1. Remove the ashtray.
2. Remove the (2) phillips screws from the ashtray location.
3. Remove the (2) phillips screws from above the instrument gauges.
4. Lower the steering wheel all the way down.
5. Carefully remove the dash trim bezel from around the Radio/Climate controls.
6. Disconnect all harnesses from the Radio/Climate control trim bezel and remove the trim bezel.
7. Remove the (6) phillips screws securing the Radio to the sub-dash.
8. Pull the Radio forward, disconnect the wire harness and antenna lead from the radio and remove radio.

2001-06 HYUNDAI SANTA FE

DASH DISASSEMBLY


1. Remove the ashtray.
2. Remove the (2) phillips screws from the ashtray location.
3. Carefully unsnap and pull forward the climate control unit.
4. Disconnect the harnesses from the climate control unit and remove climate control unit.
5. Remove the (2) phillips screws from the bottom edge of the Radio trim bezel.
6. Gently lift upward on the bottom edge of the radio trim bezel to release.
7. Gently pull the top of the radio trim bezel forward to release.
8. Disconnect all harnesses from the radio trim bezel and remove trim bezel.
9. Remove the (4) phillips screws securing the Radio to the sub-dash.
10. Pull the Radio forward, disconnect the wire harness and antenna lead and remove the radio.

2002-05 HYUNDAI SONATA


DASH DISASSEMBLY

1. Open the ashtray.
2. Starting at the bottom, carefully unsnap the trim bezel around the radio.
3. Disconnect all harnesses from the climate controls, hazard button and clock and remove the trim bezel.
4. Remove the (4) phillips screws securing the radio to the sub-dash.
5. Pull the radio forward, disconnect the wire harness and antenna lead and remove the radio.

NOTES

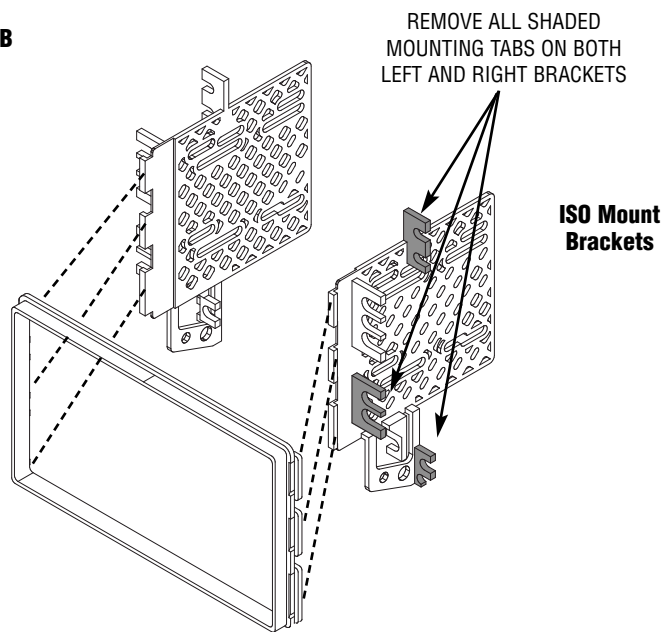KIT ASSEMBLY INSTRUCTIONS**Fig. B**

6. Remove the (1) Phillips screw from each side of the lower edges of the Radio/Climate control trim bezel.
7. Remove the (1) Phillips screw from below the ashtray.
8. Remove the beauty covers and Phillips screws from each side of the lower forward sections of the center console base section.
9. Using a panel removal tool, remove the (1) panel fastener clip at the lower front section of the console.
10. Carefully pull the console trim back to allow radio/climate control trim bezel to be pulled outward.
11. Carefully pull radio/Climate control trim bezel forward, disconnect all harnesses from rear of bezel and remove bezel.
12. Remove (4) Phillips screws securing factory radio to sub-dash.
13. Remove (1) Phillips screw securing each side of the climate control to the sub-dash.
14. Carefully pull Radio and Climate control assembly forward, disconnect all harnesses and antenna lead and remove assembly.
15. Remove the (1) Phillips screw securing each side of the climate controls to the factory radio brackets and remove climate control unit. (These (2) factory screws will be used to attach the climate controls to the installation kit side brackets.)

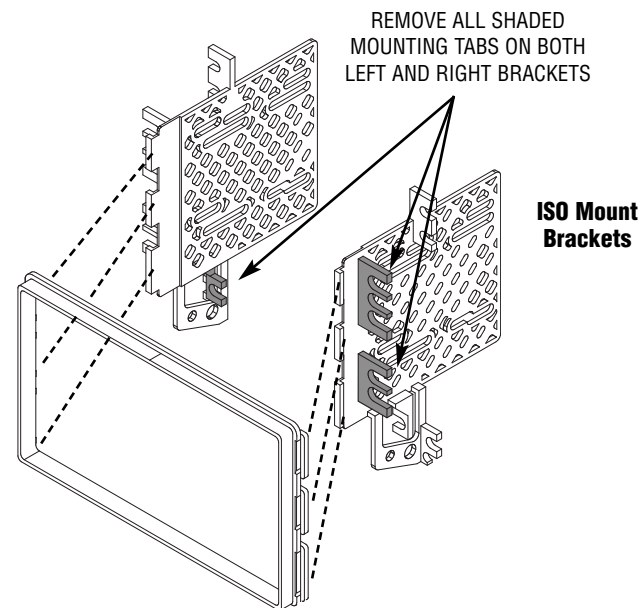2005-09 HYUNDAI TUCSON**KIT ASSEMBLY INSTRUCTIONS****Fig. C****HYUNDAI TUCSON INSTRUCTION UPDATE****ATTENTION:**

Disregard steps #13, #14 and #15 of the dash disassembly instructions for all vehicles that have the Climate Control module mounted directly to the back side of the Factory Radio dash trim Bezel.

Step # 2 of the kit assembly instructions is only required on vehicles with the Electronic Climate Control module attached directly to the radio mounting brackets. Disregard this step for all vehicles that have the Climate controls mounted directly to the back of the Factory Radio dash trim bezel.

2005-09 HYUNDAI TUCSON**DASH DISASSEMBLY**


1. Remove the small cover plate located on the lower rear side of the shift lever and remove the (2) Phillips screws then remove shifter knob.
2. Engage the emergency brake.
3. Carefully lift up on the shifter console trim, put key in ignition and turn to the on position (DO NOT START THE VEHICLE!)
4. Position the shift lever to the low position, pull upward on the console trim, disconnect the harness from the back of the shifter trim bezel and remove bezel.
5. Remove the (2) Phillips screws from the steel center crossbar that secures the center console shroud to the shifter base assembly.

RADIO & KIT INSTALLATION INSTRUCTIONS

ISO MOUNT

1. Find your vehicle and remove necessary mounting tabs.
2. Attach ISO mount brackets to rear of kit as shown below.
3. Insert radio between ISO mount brackets and loosely attach to sides of radio using screws provided with radio when possible or screws supplied with kit.
4. Slide radio forward or backward for desired look and tighten screws.


Fig. D

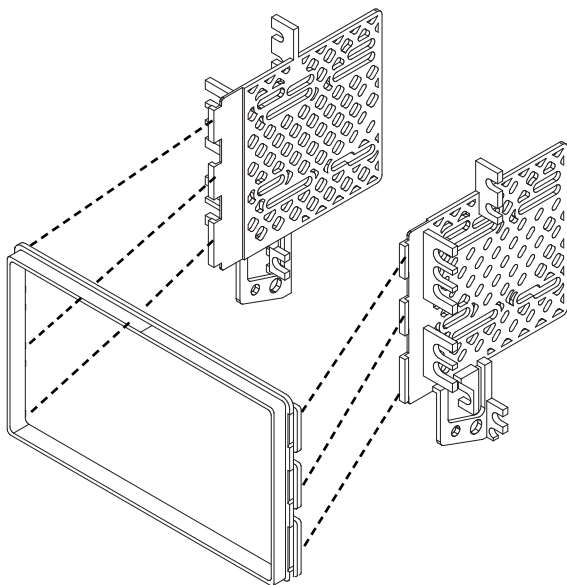

2001-06 HYUNDAI ELANTRA
2001-06 HYUNDAI SANTA FE
2002-05 HYUNDAI SONATA

KIT ASSEMBLY INSTRUCTIONS

Fig. A

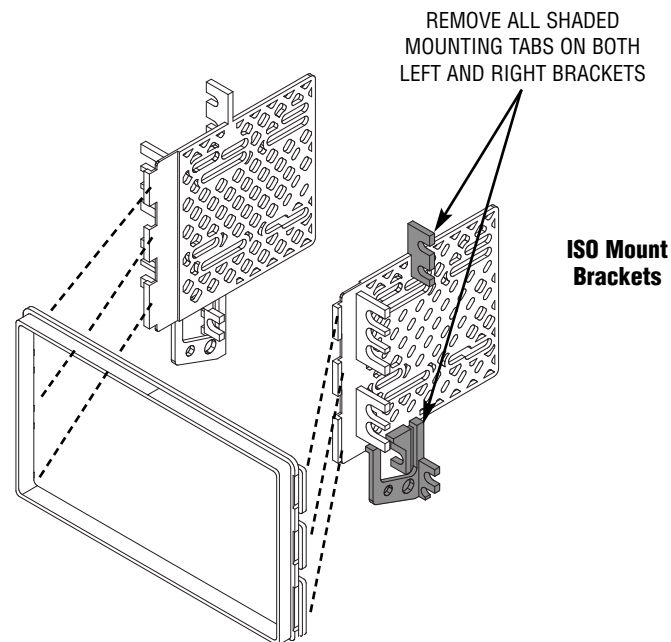

2003-08 HYUNDAI TIBURON

DASH DISASSEMBLY

1. Open the ashtray.
2. Carefully pull outward on the lower portion of the dash trim bezel / climate control panel to unclip the lower edge.
3. Continue to carefully pry outward from the sides going upward on the trim bezel / climate control panel to unfasten the side and top clips and pull the dash trim/climate control panel forward.
4. Disconnect all harnesses connected to the buttons and climate controls and remove the panel.
5. Remove the (4) Phillips screws securing the radio to the sub-dash and pull radio forward.
6. Disconnect the wire harness and antenna lead from the radio and remove radio.